


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12632	Main Street: SEIGLE_AV	Cross Street: SKYLINE_VIEW_WY	Location: W
ADA ID: E6951A5AFD25	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

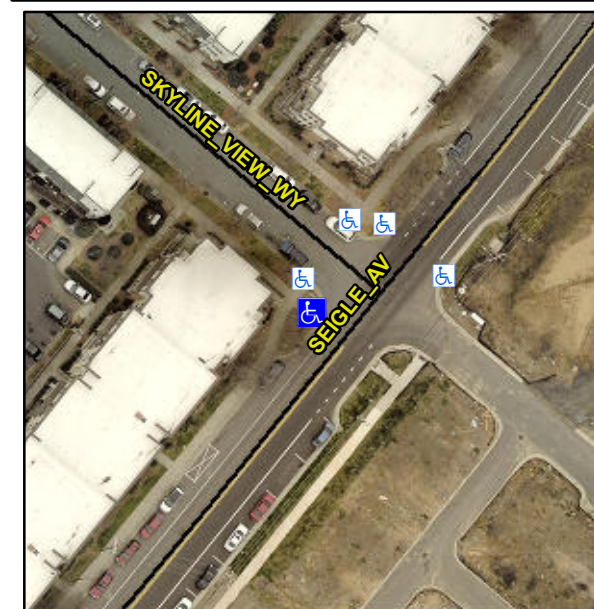

Possible Solutions:

Remove & Replace Landing. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7.2

Total Cost: \$ 700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	148.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	66.5	Yes	Grade Break Slope (%)	0.3
Yes	Ramp Slope (%)	0.9	Yes	Grade Break XSlope (%)	4.1
Yes	Ramp XSlope (%)	4.1			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.7	Yes	DWS Length (in)	25.0
No	Landing X Slope (%)	3.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	15.5
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	2.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	4.5
N/A	Painted X Walk1?	No		Road Slope (%)	4.7
	X Walk 1 Direction	To SE		Road X Slope (%)	4.9
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.9	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.6

Street 1 Name	SEIGLE AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

