


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10028048	Main Street: HARTFORD_AV	Cross Street: N/A	Location: SE
ADA ID: E6EE7DA96237	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 26.25			

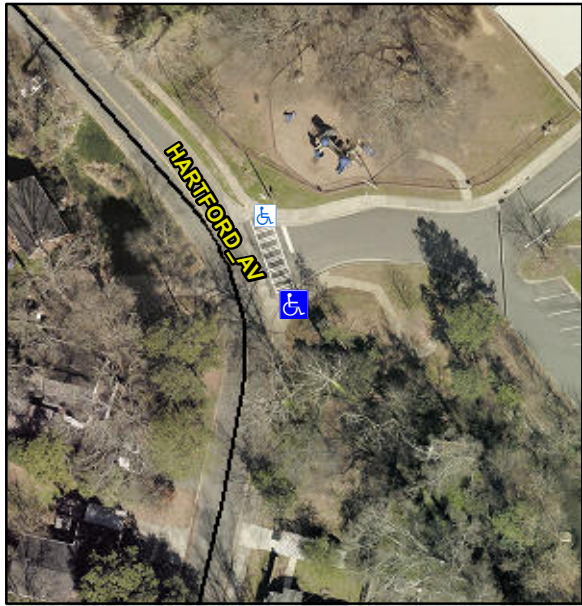

Street 1 NameENTRANCE

Stop Condition-Street 1StopSign

Street 2 NameHARTFORD AV

Stop Condition-Street 2None

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Total Cost:

\$3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	65.0	N/A	Ramp Length RT (in)	47.0
Yes	Ramp Width LT (in)	82.0	Yes	Ramp Width RT (in)	82.0
No	Ramp Slope LT (%)	13.2	Yes	Ramp Slope RT (%)	1.4
Yes	Ramp XSlope LT (%)	0.8	No	Ramp XSlope RT (%)	2.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	110.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	6.2
	X Walk 1 X Slope (%)	7.1		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.7	N/A	Clear Space?	N/A
	Road X Slope (%)	5.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.4