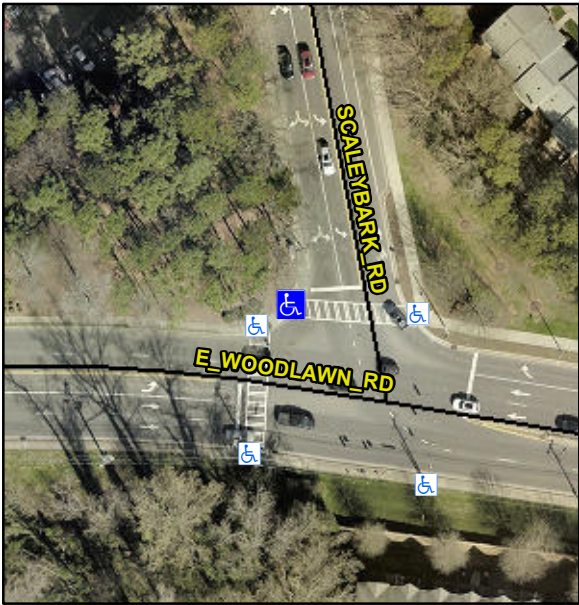


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18166	Main Street: WOODLAWN_RD	Cross Street: SCALEYBARK_RD	Location: NW
ADA ID: E7122B724D93	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	59.0	N/A	Ramp Length RT (in)	160.0
			Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	58.0
			Yes	Ramp Slope LT (%)	2.5	No	Ramp Slope RT (%)	9.5
			Yes	Ramp XSlope LT (%)	1.4	Yes	Ramp XSlope RT (%)	1.0
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
	Surveyor Notes:		N/A	Shared Landing?	N/A			
	LT RP < 5%		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	PROW/ADA:		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	R304.3.2			X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	106.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	5.0
		Total Cost:	\$	1600.00				

Street 1 Name	SCALEYBARK RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

