


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 3351	Main Street: FAIRLEA_DR	Cross Street: PROSPERITY_CHURCH_RD	Location: S
ADA ID: E7BFA4F9A09D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 33.75

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

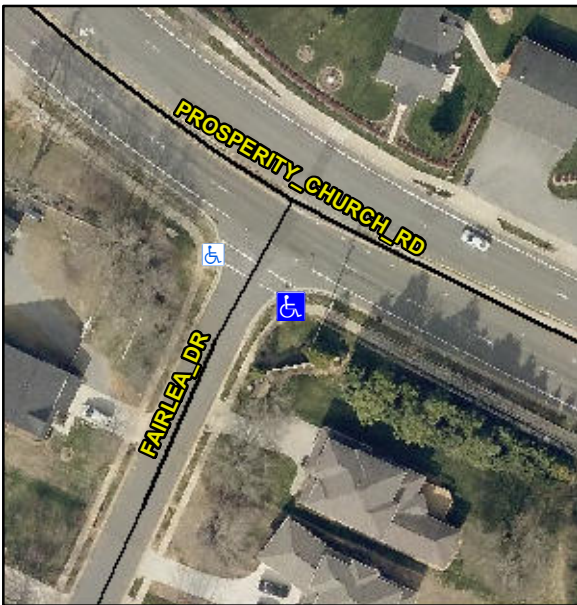

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.5	Yes	Ramp Slope (%)	7.8
No	Ramp Width (in)	36.5	No	Ramp XSlope (%)	7.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	91.0
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	4.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	5.0	N/A	Clear Space?	N/A
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name           **PROSPERITY CHURCH RD**  
 Stop Condition-Street 2           **None**  
 Street 2 Name           **FAIRLEA DR**  
 Stop Condition-Street 1           **StopSign**

