

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12354	Main Street: ELDRIDGE_ST	Cross Street: MORRIS_ST	Location: NW
ADA ID: E7E937E47023	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 4	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

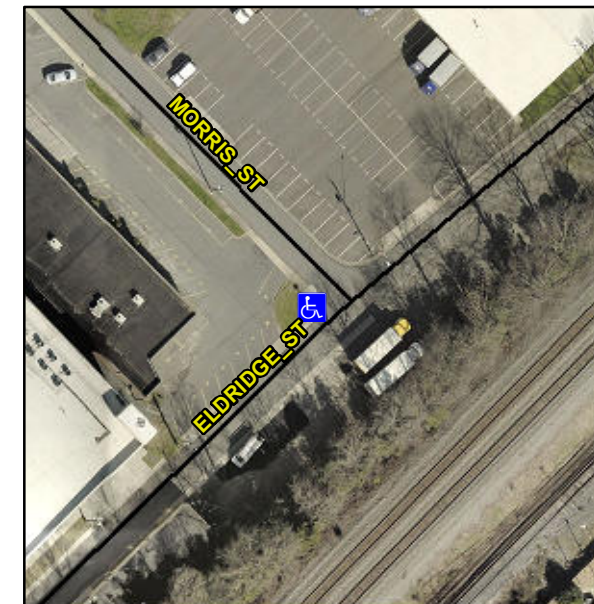

Possible Solutions:

**Remove & Replace Landing.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	52.0	N/A	Ramp Length RT (in)	50.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
Yes	Ramp Slope LT (%)	7.2	Yes	Ramp Slope RT (%)	5.4
Yes	Ramp XSlope LT (%)	1.3	Yes	Ramp XSlope RT (%)	1.4
No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	37.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.6	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	3.5
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	1.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.1	N/A	Clear Space?	Yes
	Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	2.5

Total Cost: \$ 1250.00

