


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: 3RD_ST	Cross Street: JOHN_BELK_FY	Location: E
ADA ID: E7FC7D4ED055	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

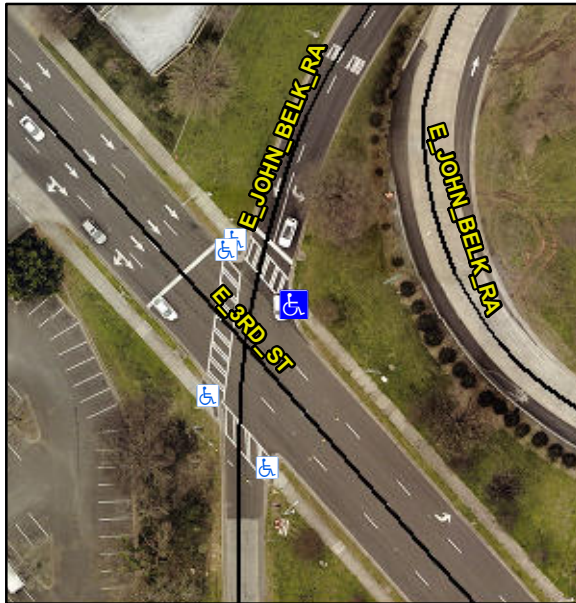

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.5.2

Street 1 Name	JOHN BELK FRWY
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ **1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	64.0	No	Grade Break?	No
Yes	Ramp Width (in)	84.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	0.3	N/A	Grade Break XSlope (%)	N/A
No	Ramp XSlope (%)	3.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	84.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.7	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	2.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	2.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.5
	X Walk 1 Direction	To NW		Road X Slope (%)	1.2
	X Walk 1 Width (in)	118.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.2	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.4

