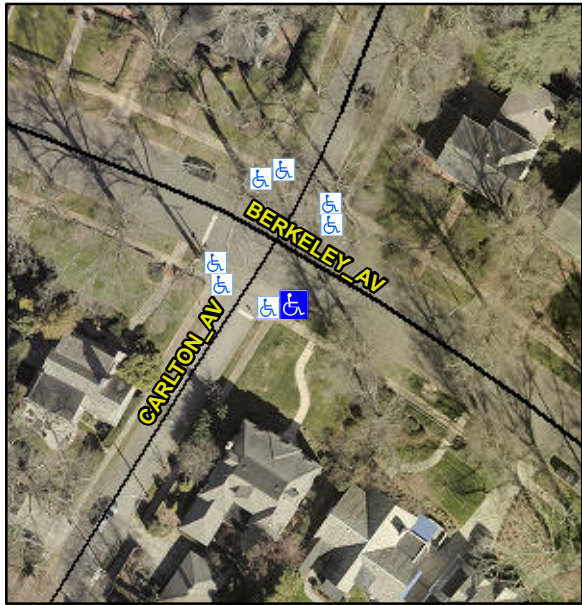


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14311	Main Street: BERKELEY_AV	Cross Street: CARLTON_AV	Location: SE
ADA ID: E7FEBBC5E660	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.2.2, R304.5.3				
	Street 1 Name	BERKELEY AV			
	Stop Condition-Street 1	StopSign			
	Street 2 Name	N/A			
	Stop Condition-Street 2	N/A			
Total Cost:		\$	1600.00		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	61.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	9.4	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	2.6			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No			
	X Walk 1 Direction	To NE			
	X Walk 1 Width (in)	N/A			
	X Walk 1 Slope (%)	3.3	N/A	Clear Space?	N/A
	X Walk 1 X Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Any Obstructions?	N/A			
	Obstruction Type		Yes	Storm Grate/Utility Type	N/A
		N/A	N/A	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.7

