


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 13189	Main Street: HAWTHORNE_LN	Cross Street: SUNNYSIDE_AV	Location: NE
ADA ID: E805562C7000	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

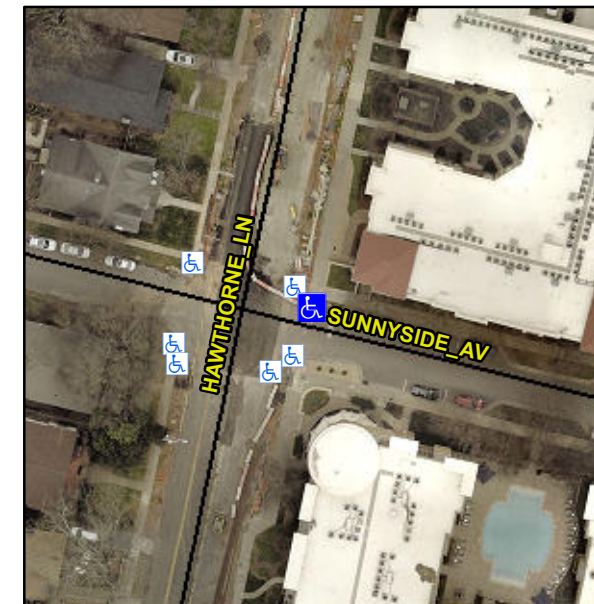

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter. Utility Present.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R304.5.4, R302.3, R402.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	40.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	92.0	Yes	Grade Break Slope (%)	3.9
Yes	Ramp Slope (%)	0.5	Yes	Grade Break XSlope (%)	1.2
Yes	Ramp XSlope (%)	1.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	103.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	15.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	No		Road Slope (%)	3.7
	X Walk 1 Direction	To S		Road X Slope (%)	0.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.5	No	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.0

Total Cost: \$ 6550.00

