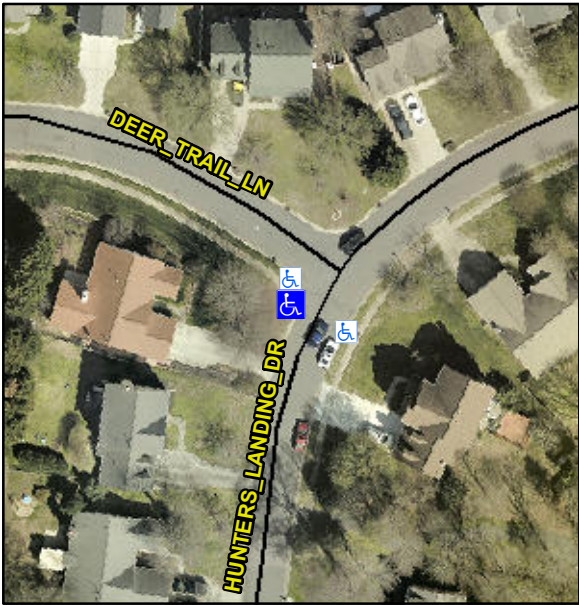


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 22962	Main Street: DEER_TRAIL_LN	Cross Street: HUNTERS_LANDING_DR	Location: SW
ADA ID: E860CB25730C	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.			N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	6.8
				No	Ramp Width (in)	45.0	Yes	Ramp XSlope (%)	0.1
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:			N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:			R304.5.1	N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	5.1		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
Street 1 Name			HUNTERS LANDING DR	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2			None		Road Slope (%)	N/A	N/A	Clear Space?	N/A
Street 2 Name			N/A		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Stop Condition-Street 1			N/A	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good
Total Cost:			\$ 1850.00						

