

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10038358	Main Street: SOUTH_BV	Cross Street: N/A	Location: SE
ADA ID: E8D925560B66	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

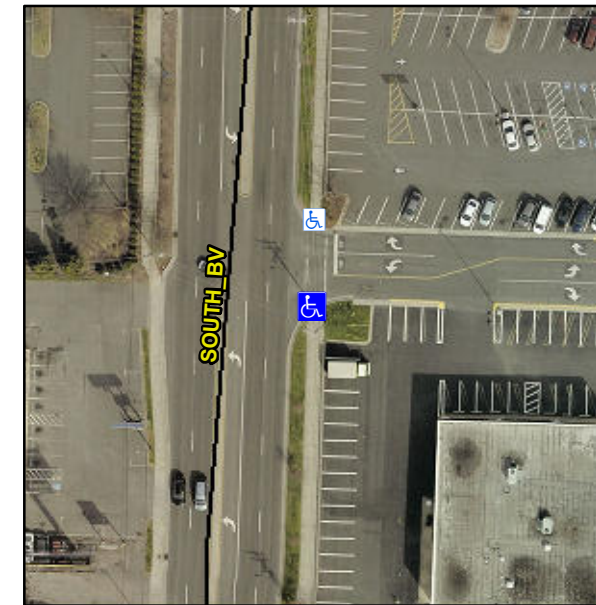

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3, R304.5.2, R305.1.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	128.0	No	Grade Break?	No
Yes	Ramp Width (in)	95.0	N/A	Grade Break Slope (%)	3.5
Yes	Ramp Slope (%)	5.2	N/A	Grade Break XSlope (%)	0.2
Yes	Ramp XSlope (%)	0.4			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	82.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	96.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.3	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	33.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.6
	X Walk 1 Direction	To NW		Road X Slope (%)	1.5
	X Walk 1 Width (in)	111.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.5	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.8

Total Cost: \$ 1600.00

Street 1 Name	ENTRANCE
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

