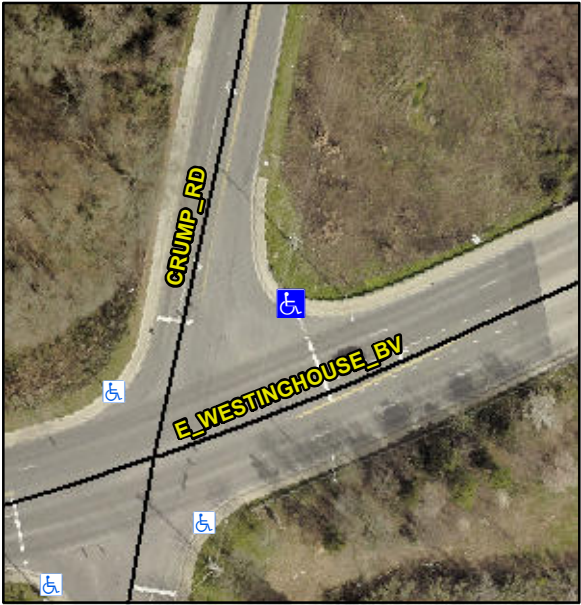


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 23717	Main Street: E WESTINGHOUSE BV	Cross Street: CHINA GROVE CHURCH RD	Location: NE
ADA ID: E8FB4B51A1E8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 12.5			

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	61.0	No	Ramp Slope (%)	10.8
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2</p>			Yes	Ramp Width (in)	51.0	Yes	Ramp XSlope (%)	0.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
<p>Street 1 Name</p> <p>CRUMP RD</p> <p>Stop Condition-Street 2</p> <p>Signal</p> <p>Street 2 Name</p> <p>E WESTINGHOUSE BV</p> <p>Stop Condition-Street 1</p> <p>Signal</p>			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To W		X Walk 2 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	3.1
				X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	0.6
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.6	N/A	Clear Space?	N/A
				Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A		N/A
			Yes	Surface Condition? (G/P)				Good

