


Intersection ID: 44730	Main Street: BENFIELD_RD	Cross Street: KOTLIK_DR	Location:	N
ADA ID: E9375BDFA75D	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
-----------------------------------------	-----------------------------------------

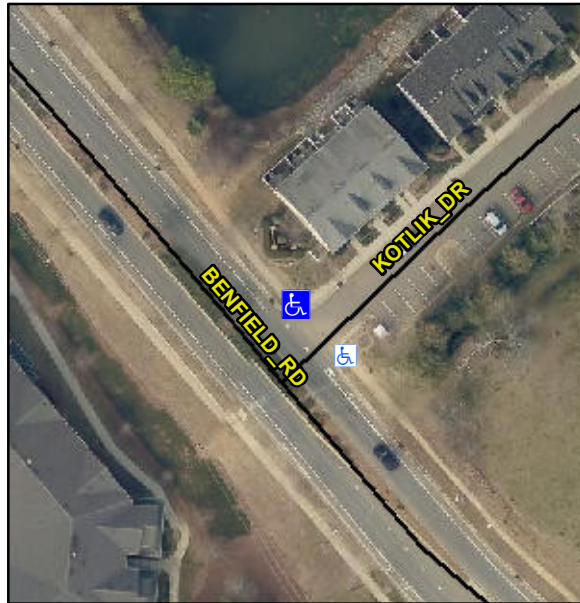

### Possible Solutions:

### Remove & Replace Entire Ramp.

Surveyor Notes:

**N/A**

PROW/ADA:

### R304.3.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	50.0
N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	68.0
N/A	Ramp Slope LT (%)	N/A	No	Ramp Slope RT (%)	16.1
N/A	Ramp XSlope LT (%)	N/A	Yes	Ramp XSlope RT (%)	0.0
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	7.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.9

**Total Cost: \$ 1600.00**

<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
<b>N/A</b>	Curb Slope (%)	<b>15.9</b>

Street 1 Name	KOTLIK DR
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

