


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10033071	Main Street: NORTH_COMMUNITY_HOUSE_RD	Cross Street: N/A	Location: SW
ADA ID: E941219ED651	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 13.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

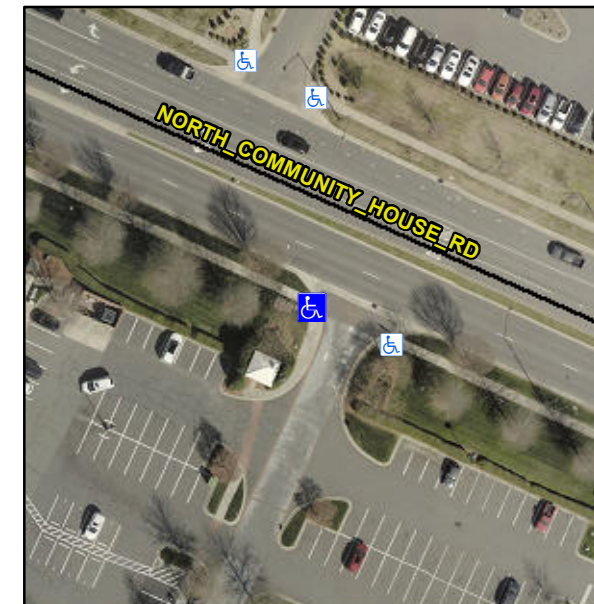

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.3.2, R304.5.3**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	77.0	N/A	Ramp Length RT (in)	71.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	58.0
No	Ramp Slope LT (%)	10.3	Yes	Ramp Slope RT (%)	1.4
No	Ramp XSlope LT (%)	2.1	No	Ramp XSlope RT (%)	4.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.3

Street 1 Name ENTRANCE

Stop Condition-Street 1 StopSign

Street 2 Name N/A

Stop Condition-Street 2 N/A

