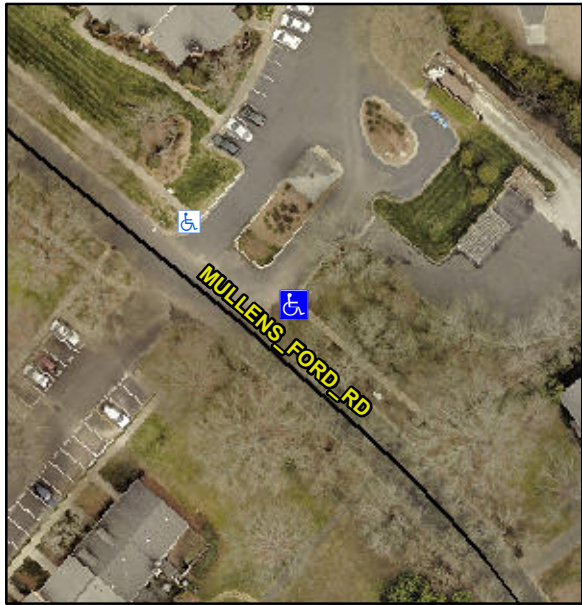


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10032428	Main Street: MULLENS_FORD_RD	Cross Street: N/A	Location: NW
ADA ID: E97B8A35E737	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 37.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)		70.0	No	Ramp Slope (%)		12.6
			Yes	Ramp Width (in)		48.0	No	Ramp XSlope (%)		5.7
			N/A	Flare Type LT		N/A	N/A	Flare Type RT		N/A
			N/A	Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)		N/A
			N/A	Flare Traversable LT?		N/A	N/A	Flare Traversable RT?		N/A
			N/A	Landing Length (in)		N/A	N/A	DWS Provided?		N/A
			N/A	Landing Width (in)		N/A	N/A	DWS Contrast?		N/A
			N/A	Landing Slope (%)		N/A	N/A	DWS Length (in)		N/A
			N/A	Landing X Slope (%)		N/A	N/A	DWS Full Width?		N/A
Surveyor Notes:		N/A			N/A	Landing Curb? (Y/N)		N/A	N/A	N/A
PROW/ADA:		Not Found, R304.2.2, R304.5.3			N/A	Shared Landing?		N/A		
					N/A	Gutter Ponding?		N/A	N/A	N/A
					N/A	Gutter Lip Ht (in)		N/A	N/A	N/A
					N/A	Painted X Walk1?		No	N/A	N/A
						X Walk 1 Direction		To N		N/A
					N/A	X Walk 1 Width (in)		N/A	N/A	N/A
						X Walk 1 Slope (%)		1.9		N/A
						X Walk 1 X Slope (%)		1.4		N/A
					N/A	Ramp inside XWalk1?		N/A	N/A	N/A
						Road Slope (%)		N/A	N/A	N/A
						Road X Slope (%)		N/A	N/A	N/A
					N/A	Any Obstructions?		N/A	N/A	N/A
						Obstruction Type				
								N/A		N/A
								Yes	Good	
Street 1 Name		ENTRANCE								
Stop Condition-Street 2		None								
Street 2 Name		N/A								
Stop Condition-Street 1		N/A								
Total Cost:		\$ 1850.00								

Street 1 Name	ENTRANCE
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

