


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: SPEER_BV	Cross Street: NATIONAL_AV	Location: NE
ADA ID: E9BA7A054B43	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

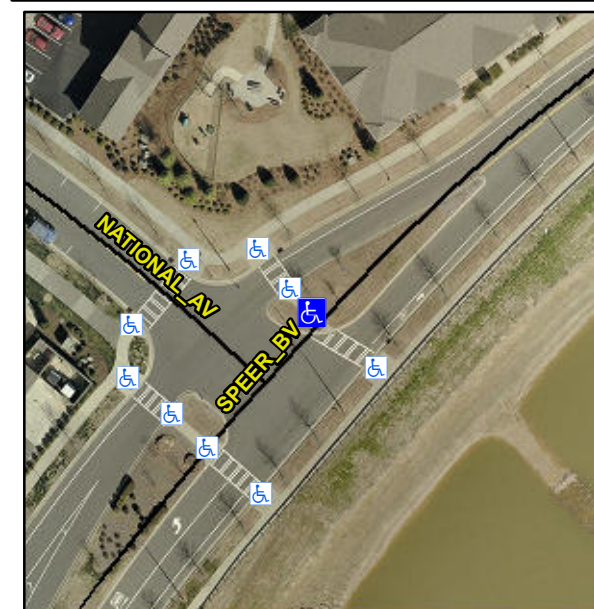

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

LOCATED ON MEDIAN

PROW/ADA:

R304.5.3, R304.5.4

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	110.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	52.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	1.7	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	2.9			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	15.1	N/A	Flare Slope RT (%)	8.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	52.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	54.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	26.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	Yes		Road Slope (%)	4.8
	X Walk 1 Direction	To SE		Road X Slope (%)	2.0
	X Walk 1 Width (in)	112.0		Clear Space?	Yes
	X Walk 1 Slope (%)	4.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.3

