

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14213	Main Street: CENTRAL_AV	Cross Street: ROSEHAVEN_DR	Location: NE
ADA ID: E9C7836BC1B5	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

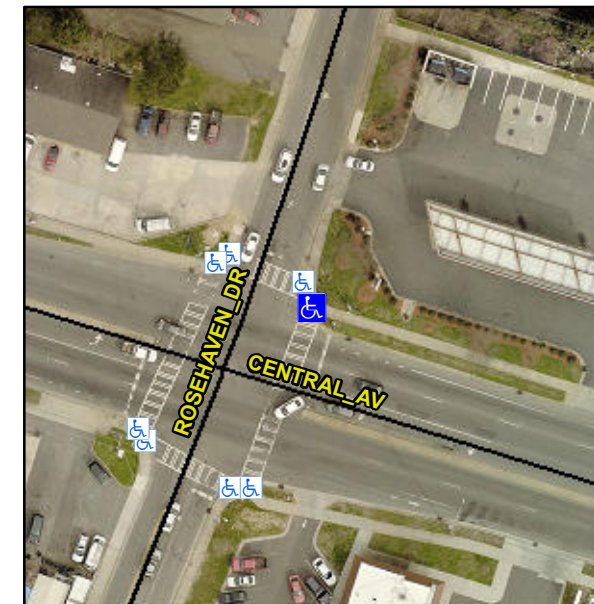

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	40.0	N/A	Ramp Length RT (in)	51.0
Yes	Ramp Width LT (in)	75.0	Yes	Ramp Width RT (in)	75.0
Yes	Ramp Slope LT (%)	0.4	Yes	Ramp Slope RT (%)	5.6
No	Ramp XSlope LT (%)	4.0	Yes	Ramp XSlope RT (%)	1.9
Yes	Landing Length (in)	85.5	Yes	DWS Provided?	Yes
No	Landing Width (in)	34.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.3	Yes	DWS Length (in)	28.0
No	Landing X Slope (%)	2.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Replace	Curb Slope (%)	23.6

