


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 28159	Main Street: CRUDEN_BAY_WY	Cross Street: JAMES_RICHARD_DR	Location: NE
ADA ID: EA0D81DEC0B7	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

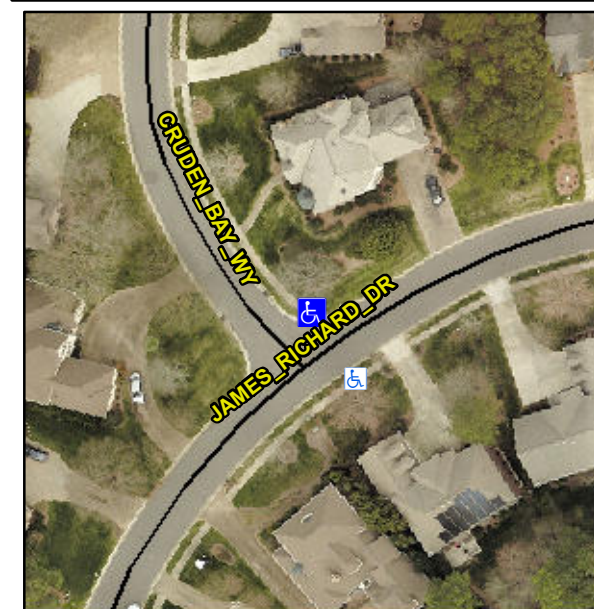

Possible Solutions:

**Remove & Replace Detectable
Warning System.**

Surveyor Notes:

N/A

PROW/ADA:

R305.2

Street 1 Name	JAMES RICHARD DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.0	Yes	Ramp Slope (%)	6.1
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.6	N/A	Flare Slope RT (%)	2.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

