

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

58.5

59.0

4.1

2.7

9.1

5.2

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: 8498 Main Street: KENNEDY ST **Cross Street: N GRAHAM ST** Location: **Overall Compliance: No** ADA ID: EA355DA23075 Ramp Type: Combination2 Initial Pass/Fail: Fail Severity Score: 33.75

**Codes/Mitigation Info/Possible Solution** 

Field Measurements/Component Compliance

N/A

N/A

N/A

N/A

Nο

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Curb Slope (%)

Flare Traversable RT?

Data

47.0

59.0

7.8

2.0

28.5

42.5

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)


Landing Curb? (Y/N)

Shared Landing?

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

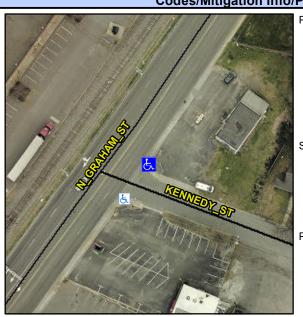

StopSign Street 1 Name Stop Condition-Street 1 **KENNEDY ST** N/A Street 2 Name Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. Yes Yes Yes N/A No Surveyor Notes: N/A **RT RP < 5%** N/A N/A N/A N/A PROW/ADA N/A Not Found, R304.5.1, R304.2.2, N/A R304.5.3 N/A N/A

Total Cost:



1600.00

N/A Gutter Ponding? N/A N/A Gutter Slope (%) N/A N/A N/A Gutter Lip Ht (in) N/A Gutter X Slope (%) N/A N/A N/A Painted X Walk1? No Painted X Walk2? N/A To SW X Walk 1 Direction X Walk 2 Direction N/A X Walk 1 Width (in) N/A X Walk 2 Width (in) N/A 1.4 X Walk 2 Slope (%) N/A X Walk 1 Slope (%) X Walk 1 X Slope (%) 3.8 X Walk 2 X Slope (%) N/A N/A Ramp inside XWalk1? N/A N/A Ramp inside XWalk2? N/A Road Slope (%) N/A Clear Space? N/A Road X Slope (%) N/A N/A Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type** N/A N/A Storm Grate/Utility Hazard? N/A Storm Grate/Utility Type N/A Yes Surface Condition? (G/P) Good 13.7

