


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10036734		Main Street: S DAVIDSON ST		Cross Street: N/A		Location: NE					
ADA ID: EA3C7D692ACC		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
 Street 1 NameS DAVIDSON ST Stop Condition-Street 1None Street 2 NameN/A Stop Condition-Street 2N/A				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp. Remove & Replace Gutter.		N/A	Ramp Length (in)	98.0	No	Grade Break?	No
						Yes	Ramp Width (in)	90.0	N/A	Grade Break Slope (%)	N/A
						Yes	Ramp Slope (%)	6.1	N/A	Grade Break XSlope (%)	N/A
						Yes	Ramp XSlope (%)	3.2			
						Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
						Yes	Landing Length (in)	86.0	Yes	DWS Provided?	Yes
						Yes	Landing Width (in)	90.0	Yes	DWS Contrast?	Yes
		Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.5				
		Yes	Landing X Slope (%)	0.5	Yes	DWS Full Width?	Yes				
		N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0				
		N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0				
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	5.5				
		N/A	Painted X Walk1?	No		Road Slope (%)	0.8				
			X Walk 1 Direction	To SW		Road X Slope (%)	5.3				
			X Walk 1 Width (in)	N/A		Clear Space?	Yes				
			X Walk 1 Slope (%)	0.8	N/A	Clear Space to XWalk (in)	N/A				
			X Walk 1 X Slope (%)	5.3	Yes	Storm Grate/Utility Hazard?	No				
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type					
		Yes	Any Obstructions?	No			N/A				
			Obstruction Type		Yes	Surface Condition? (G/P)	Good				
					N/A	Curb Slope (%)	1.1				
		Total Cost:		\$	2350.00						

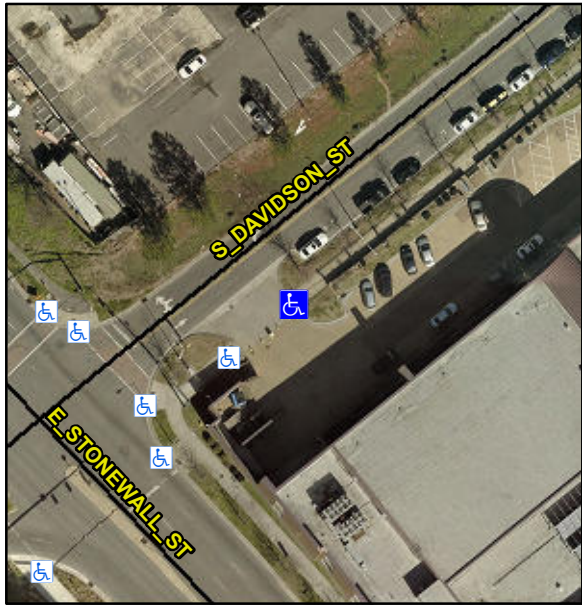