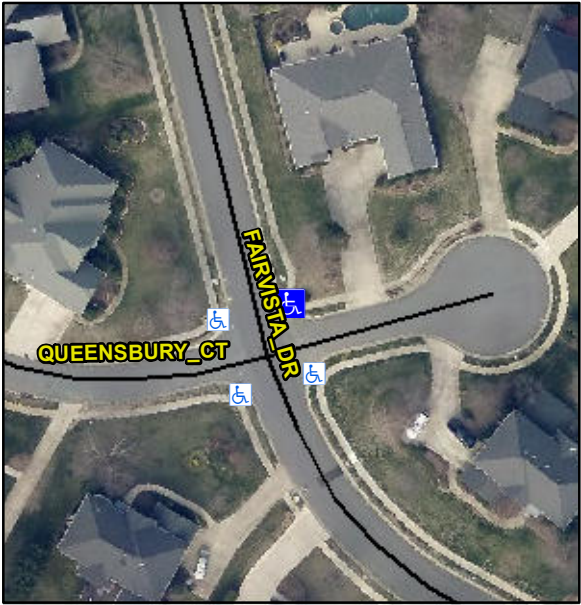


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 2710	Main Street: FAIRVISTA_DR	Cross Street: QUEENSBURY_CT	Location: NE
ADA ID: EAF3EFC1EAD7	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 30.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
			N/A	Ramp Length (in)	74.0	No
			Yes	Ramp Width (in)	51.0	No
			N/A	Flare Type LT	Sloped	N/A
			N/A	Flare Slope LT (%)	2.7	Yes
			N/A	Flare Traversable LT?	Yes	N/A
			No	Landing Length (in)	N/A	No
			No	Landing Width (in)	N/A	No
			No	Landing Slope (%)	N/A	N/A
			No	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	No	N/A
			N/A	Shared Landing?	No	
			Yes	Gutter Ponding?	No	Yes
			No	Gutter Lip Ht (in)	0.5	No
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To W	
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	6.2	
				X Walk 1 X Slope (%)	4.9	
			N/A	Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	1.9	N/A
				Road X Slope (%)	3.4	N/A
			Yes	Any Obstructions?	No	Yes
				Obstruction Type		
					N/A	N/A
			Yes	Surface Condition? (G/P)		Good

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2**

Total Cost: \$ 3950.00

Street 1 Name FAIRVISTA DR  
Stop Condition-Street 2 None  
Street 2 Name QUEENSBURY CT  
Stop Condition-Street 1 StopSign

