

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 47775 Main Street: BEREWICK\_COMMONS\_PKY Cross Street: TRAILMOOR\_RD Location: NE

ADA ID: EB1C8360827E Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance



Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

WWW.	
treet 1 Name	BEREWICK COMMONS PY
top Condition-Street 2	None
treet 2 Name	TRAILMOOR RD
top Condition-Street 1	StopSign


Comp	liance Description	Data	Comp	liance	Description	Data
N/A	Ramp Length (in)	52.0	No	No Ramp Slope (%)		11.0
Yes	Ramp Width (in)	48.0	No	Ramp	Ramp XSlope (%)	
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Wa	lk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	0.2		X Wa	lk 2 X Slope (%)	0.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	0.8	N/A	Clear	Space?	N/A
	Road X Slope (%)	0.3	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A
	Obstruction Type			Storm	n Grate/Utility Type	
		N/A				N/A

Yes

Surface Condition? (G/P)

Good



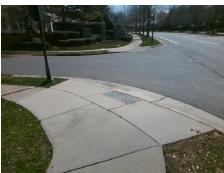

Total Cost:



3200.00