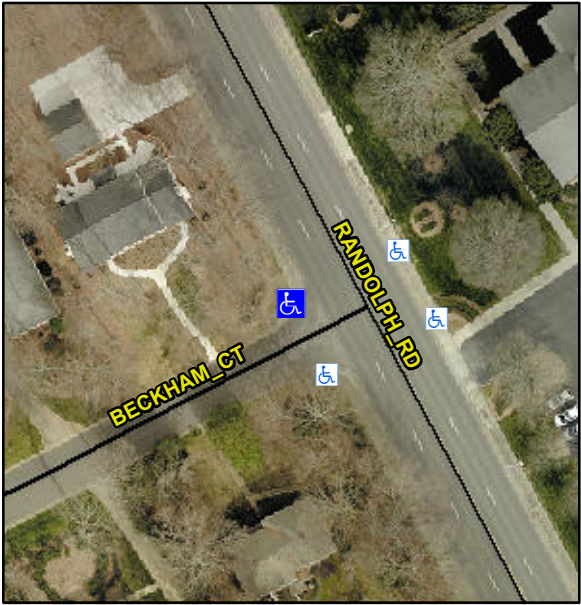


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18571	Main Street: BECKHAM_CT	Cross Street: RANDOLPH_RD	Location: NW
ADA ID: EB20C7C55172	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	71.0	No	Ramp Slope (%)	10.6
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2</p>		No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	0.5
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
<p>Street 1 Name</p> <p>BECKHAM CT</p> <p>Stop Condition-Street 2</p> <p>StopSign</p> <p>Street 2 Name</p> <p>RANDOLPH RD</p> <p>Stop Condition-Street 1</p> <p>None</p>		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To S		X Walk 2 Direction	To E
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	1.1
			X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	3.1
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.8	N/A	Clear Space?	N/A
			Road X Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good

