

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 29711	Main Street: GATESVILLE_LN	Cross Street: ROBESON_CREEK_DR	Location: S
ADA ID: EB337FC20B65	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

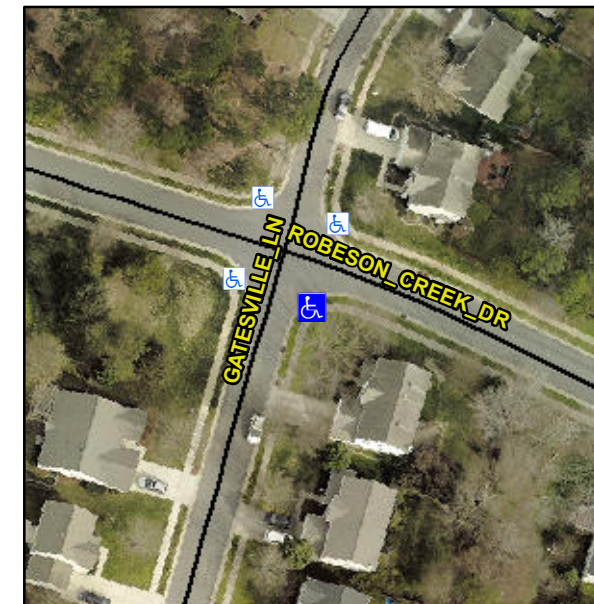

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R305**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.5	N/A	Flare Slope RT (%)	6.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.5	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.8	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	6.8
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.4	N/A	Clear Space?	Yes
	Road X Slope (%)	5.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name ROBESON CREEK DR

Stop Condition-Street 2 None

Street 2 Name GATESVILLE LN

Stop Condition-Street 1 StopSign

