


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11911	Main Street: W_7TH_ST	Cross Street: N_CHURCH_ST	Location: E
ADA ID: EB79E38C7364	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

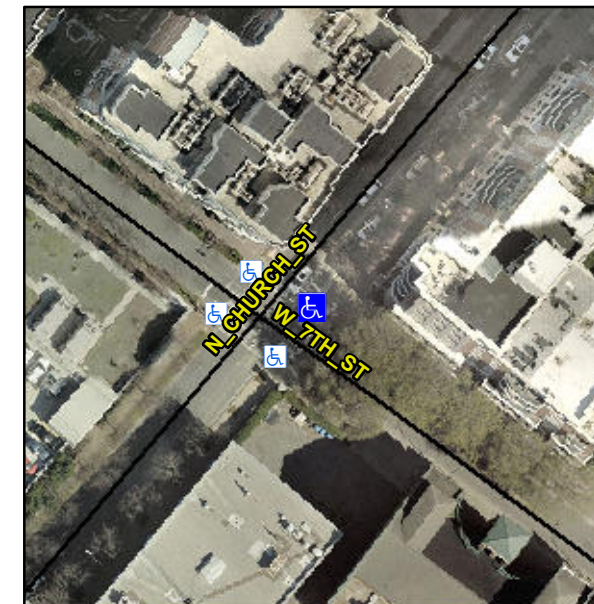

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	90.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	58.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	No	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.4	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	50.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.4	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	88.0	N/A	X Walk 2 Width (in)	107.0
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	5.4
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	0.7
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.7	N/A	Clear Space?	Yes
	Road X Slope (%)	0.9	Yes	Clear Space to XWalk (in)	50.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name N CHURCH ST
 Stop Condition-Street 2 Signal
 Street 2 Name W 7TH ST
 Stop Condition-Street 1 Signal

