


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12082	Main Street: ALLEN_ST	Cross Street: E_16TH_ST	Location:	N
ADA ID: EBE8096BE67D	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 2.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

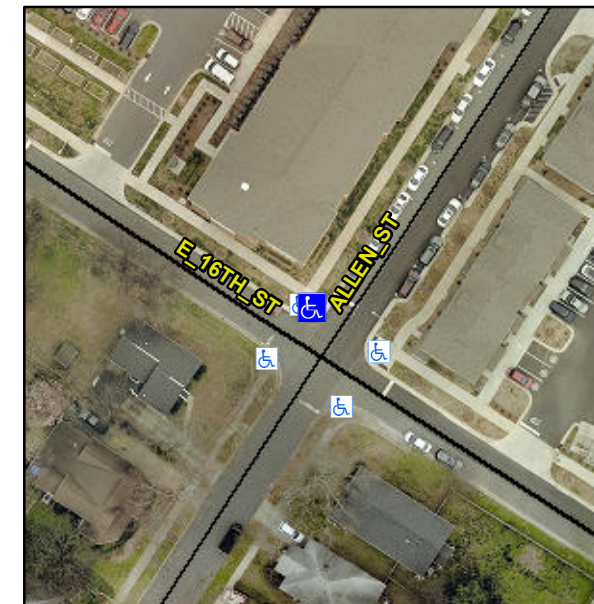

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R305.1.4, R305.2**

Street 1 Name	E 16TH ST
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	56.0	No	Grade Break Slope (%)	8.9
Yes	Ramp Slope (%)	6.4	No	Grade Break XSlope (%)	3.1
Yes	Ramp XSlope (%)	1.9			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	67.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.2	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.7	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	6.5
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	2.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No		Road Slope (%)	4.6
	X Walk 1 Direction	To SE		Road X Slope (%)	4.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	16.2

