


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 2897	Main Street: BELL'S_MILL_DR	Cross Street: HARBURN_FOREST_DR	Location: SE
ADA ID: EC1D5BE06A0F	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

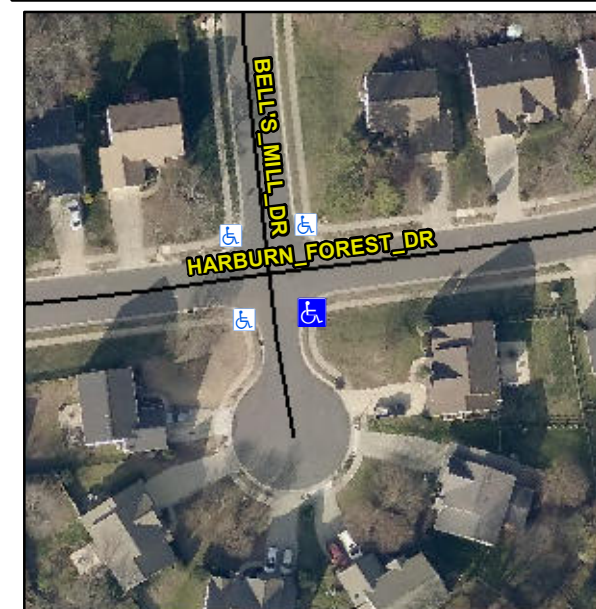

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	72.0	No	Ramp XSlope (%)	4.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.6	Yes	Flare Slope RT (%)	6.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	72.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.8	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	4.1	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	7.8
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	3.3
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

