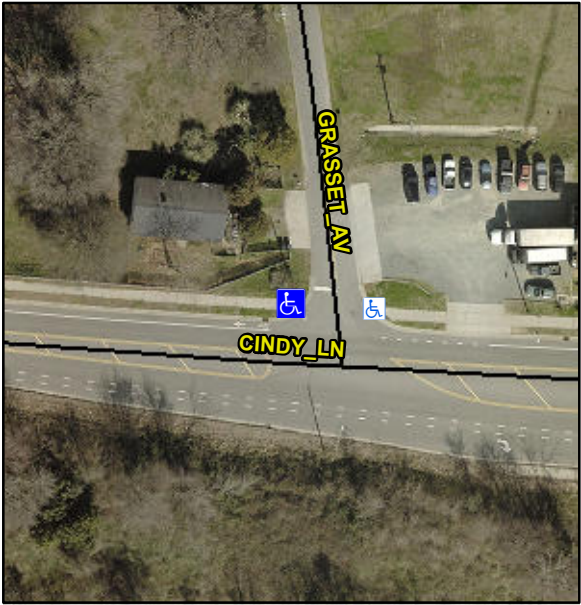


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6874	Main Street: CINDY_LN	Cross Street: GRASSET_AV	Location: NW
ADA ID: EC3FFE943936	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	72.0
			Yes	Ramp Width (in)	75.0
			Yes	Ramp Slope (%)	6.8
			No	Ramp XSlope (%)	2.3
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	0.0
			N/A	Landing Width (in)	0.0
			N/A	Landing Slope (%)	0.0
			N/A	Landing X Slope (%)	0.0
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	0.0
			N/A	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To E
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	3.1
				X Walk 1 X Slope (%)	6.5
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3</p>			N/A	Ramp inside XWalk1?	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	11.0

Street 1 Name	GRASSET AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

