


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9243	Main Street: DEAN_ST	Cross Street: WADDELL_ST	Location:	N
ADA ID: ECA06427A2A6	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0.25
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

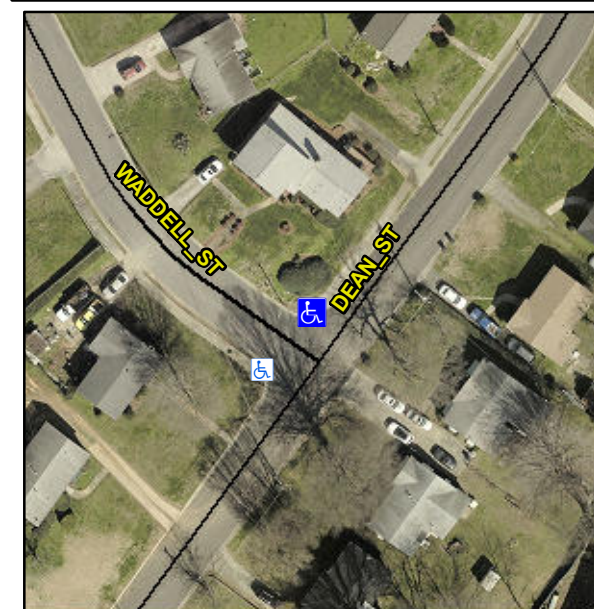

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.3, R305.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	BlendTrans Slope (%)	2.2
Yes	Ramp Width (in)	60.5	No	BlendTrans XSlope (%)	2.8
Yes	Flare Type LCurbed_NoWalkSurface	N/A	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	N/A	No	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.3		Clear Space?	Yes
	Road X Slope (%)	6.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.0

Street 1 Name WADDELL ST

Stop Condition-Street 1 StopSign

Street 2 Name N/A

Stop Condition-Street 2 N/A

