

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)




Intersection ID: 13559 Main Street: W\_WORTHINGTON\_AV Cross Street: WEST\_BV Location: NE ADA ID: ED1A531B3CD2 Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 8.75

Codes/Mitigation Info/Possible Solution



W WORTHINGTON AV Street 1 Name Stop Condition-Street 2 StopSign Street 2 Name N/A Stop Condition-Street 1 N/A

| "         | 1 0001810 001411011           |     |
|-----------|-------------------------------|-----|
| 8         | Possible Solutions:           | Con |
|           | Remove & Replace Entire Ramp. | N/A |
| è         |                               | No  |
| 300       |                               | N/A |
| Salan     |                               | N/A |
|           |                               | N/A |
|           |                               | N/A |
|           | Surveyor Notes:               | N/A |
| -         | N/A                           | N/A |
| 1         |                               | N/A |
| 30.00     |                               | N/A |
| 4         |                               | N/A |
|           | PROW/ADA:                     | N/A |
| -         | Not Found, R304.5.1           | N/A |
| 1         |                               | N/A |
| TARREST . |                               |     |
| 1         |                               | N/A |
|           |                               |     |
|           |                               | N/A |
|           |                               |     |
|           |                               |     |

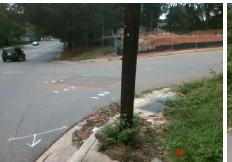



Total Cost:



1850.00

| Field Measurements/Component Compliance |                       |       |       |       |                         |      |  |  |  |
|---|-----------------------|-------|-------|-------|-------------------------|------|--|--|--|
| Compliance Description                  |                       | Data  | Compl | iance | Description             | Data |  |  |  |
| N/A                                     | Ramp Length (in)      | 48.0  | Yes   | Ramp  | Slope (%)               | 6.1  |  |  |  |
| No                                      | Ramp Width (in)       | 43.0  | Yes   | Ramp  | XSlope (%)              | 1.1  |  |  |  |
| N/A                                     | Flare Type LT         | N/A   | N/A   | Flare | Type RT                 | N/A  |  |  |  |
| N/A                                     | Flare Slope LT (%)    | N/A   | N/A   | Flare | Slope RT (%)            | N/A  |  |  |  |
| N/A                                     | Flare Traversable LT? | N/A   | N/A   | Flare | Traversable RT?         | N/A  |  |  |  |
| N/A                                     | Landing Length (in)   | N/A   | N/A   | DWS   | Provided?               | N/A  |  |  |  |
| N/A                                     | Landing Width (in)    | N/A   | N/A   | DWS   | Contrast?               | N/A  |  |  |  |
| N/A                                     | Landing Slope (%)     | N/A   | N/A   | DWS   | Length (in)             | N/A  |  |  |  |
| N/A                                     | Landing X Slope (%)   | N/A   | N/A   | DWS   | Full Width?             | N/A  |  |  |  |
| N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A   | DWS   | Offset (in)             | N/A  |  |  |  |
| N/A                                     | Shared Landing?       | N/A   |       |       |                         |      |  |  |  |
| N/A                                     | Gutter Ponding?       | N/A   | N/A   | Gutte | r Slope (%)             | N/A  |  |  |  |
| N/A                                     | Gutter Lip Ht (in)    | N/A   | N/A   | Gutte | r X Slope (%)           | N/A  |  |  |  |
| N/A                                     | Painted X Walk1?      | No    | N/A   | Paint | ed X Walk2?             | N/A  |  |  |  |
|   | X Walk 1 Direction    | To NW |       | X Wa  | lk 2 Direction          | N/A  |  |  |  |
| N/A                                     | X Walk 1 Width (in)   | N/A   | N/A   | X Wa  | lk 2 Width (in)         | N/A  |  |  |  |
|   | X Walk 1 Slope (%)    | 3.0   |       | X Wa  | lk 2 Slope (%)          | N/A  |  |  |  |
|   | X Walk 1 X Slope (%)  | 5.0   |       | X Wa  | lk 2 X Slope (%)        | N/A  |  |  |  |
| N/A                                     | Ramp inside XWalk1?   | N/A   | N/A   | Ramp  | inside XWalk2?          | N/A  |  |  |  |
|   | Road Slope (%)        | N/A   | N/A   | Clear | Space?                  | N/A  |  |  |  |
|   | Road X Slope (%)      | N/A   | N/A   | Clear | Space to XWalk (in)     | N/A  |  |  |  |
| N/A                                     | Any Obstructions?     | N/A   | N/A   | Storm | n Grate/Utility Hazard? | N/A  |  |  |  |
|   | Obstruction Type      |       |       | Storm | n Grate/Utility Type    |      |  |  |  |
|   |                       | N/A   |       |       |                         | N/A  |  |  |  |
|   |                       |       | Yes   | Surfa | ce Condition? (G/P)     | Good |  |  |  |