


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10020275	Main Street: AYRSLEY_TOWN_BV	Cross Street: N/A	Location: S
ADA ID: ED209FBC9697	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

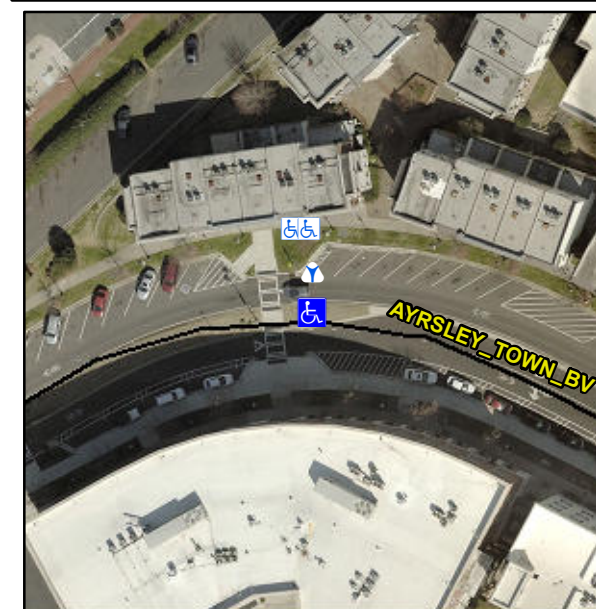

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3

Total Cost: \$ 2750.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	123.0	Yes	BlendTrans XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	9.8	Yes	Flare Slope RT (%)	3.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	123.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	104.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.7		Clear Space?	Yes
	Road X Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	6.5

Street 1 Name	AYRSLEY TOWN BV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

