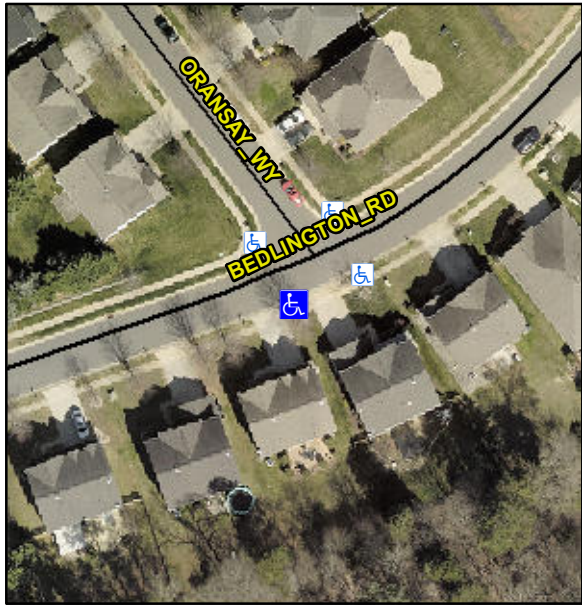


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48436	Main Street: BEDLINGTON_RD	Cross Street: ORANSAY_WY	Location: SW
ADA ID: ED4D257346A8	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance		Description	Data	Compliance		Description	Data
	Install Landing. Remove & Replace Gutter.		N/A	Ramp Length (in)	93.5	Yes	Ramp Slope (%)	6.9		
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	3.0		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	8.7	Yes	Flare Slope RT (%)	2.0		
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes		
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes		
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes		
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0		
			No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes		
		N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0			
		N/A	Shared Landing?	No						
		Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.7			
		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	3.4			
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A			
			X Walk 1 Direction	To NW		X Walk 2 Direction	N/A			
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A			
			X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	N/A			
			X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	N/A			
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A			
			Road Slope (%)	N/A	N/A	Clear Space?	Yes			
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No			
			Obstruction Type			Storm Grate/Utility Type				
				N/A			N/A			
					Yes	Surface Condition? (G/P)	Good			

