


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14763	Main Street: HERMITAGE_RD	Cross Street: QUEENS_RD	Location: SW
ADA ID: ED5DCC77AEA2	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

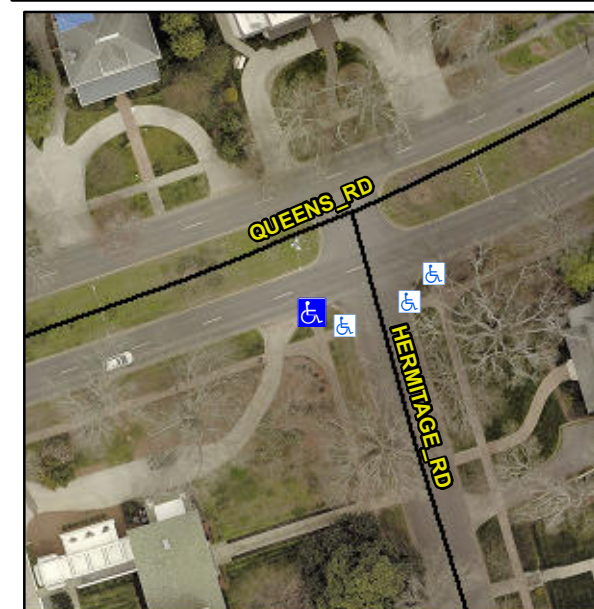

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R305.1.4, R305.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	117.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	Yes	Grade Break Slope (%)	4.8
Yes	Ramp Slope (%)	7.7	No	Grade Break XSlope (%)	2.3
No	Ramp XSlope (%)	2.6			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
Yes	Flare Slope LT (%)	2.5	Yes	Flare Slope RT (%)	0.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	65.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.8	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	0.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	15.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	5.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	No		Road Slope (%)	2.0
	X Walk 1 Direction	To NW		Road X Slope (%)	0.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.5

Total Cost: \$ 2350.00

Street 1 Name	QUEENS RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

