

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5855	Main Street: W_SUGAR_CREEK_RD	Cross Street: NEVIN_RD	Location:	N
ADA ID: EDB0636EE624	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

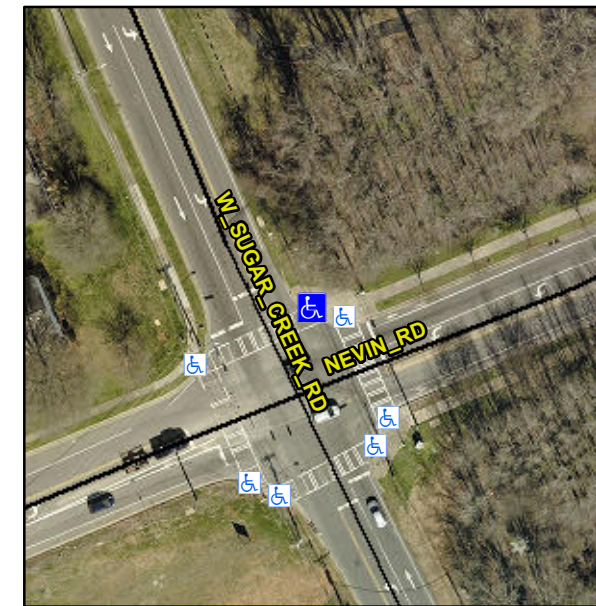

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

NO LNDG

PROW/ADA:

Not Found, R304.2.1, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	161.0	Yes	BlendTrans Slope (%)	3.1
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	6.0	Yes	Flare Slope RT (%)	7.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	103.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2		Clear Space?	Yes
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	14.1

Street 1 Name	W SUGAR CREEK RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

