


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7610	Main Street: NICOLET_GLEN_DR	Cross Street: TWEEDSMUIR_GLEN_LN	Location: SE
ADA ID: EDB7339B987B	Ramp Type: Directional	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 15
			Field Measurements/Component Compliance

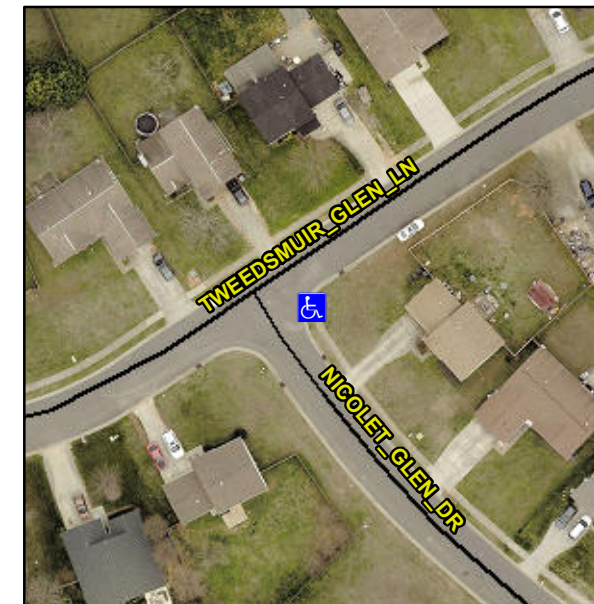

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

CRACK LT FL

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R305, R304.5.4**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	24.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	51.0	Yes	Grade Break Slope (%)	4.9
Yes	Ramp Slope (%)	6.3	No	Grade Break XSlope (%)	4.0
Yes	Ramp XSlope (%)	0.8			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	9.3	N/A	Flare Slope RT (%)	11.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
No	Landing Width (in)	47.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.5	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.7	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	13.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No		Road Slope (%)	3.4
	X Walk 1 Direction	To N		Road X Slope (%)	2.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.1

