

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52288	Main Street: STEELE_CREEK_RD	Cross Street: DIXIE_RIVER_RD	Location: W
ADA ID: EE5BCE9F5ED8	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

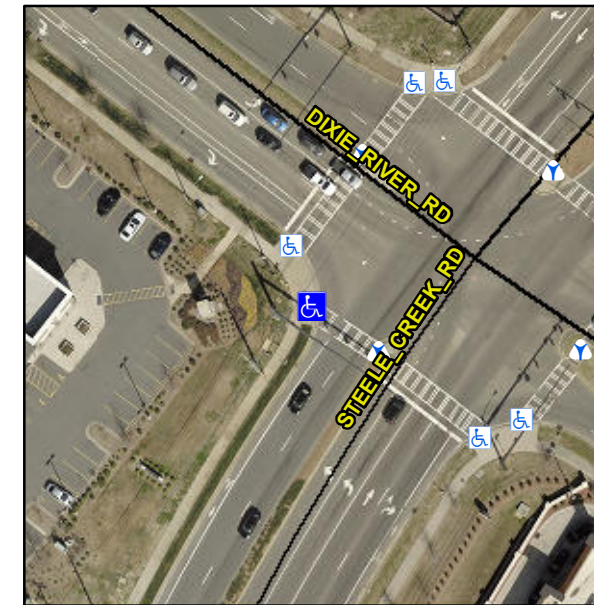

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.5.3

Street 1 Name	DIXIE RIVER RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 500.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	61.0	N/A	Ramp Length RT (in)	59.0
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	6.1	Yes	Ramp Slope RT (%)	6.4
Yes	Ramp XSlope LT (%)	1.7	Yes	Ramp XSlope RT (%)	1.3
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	46.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	2.7

