


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 21411	Main Street: MONROE_RD	Cross Street: SARDIS_RD_NORTH	Location: NE
ADA ID: EE89D08B30CE	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

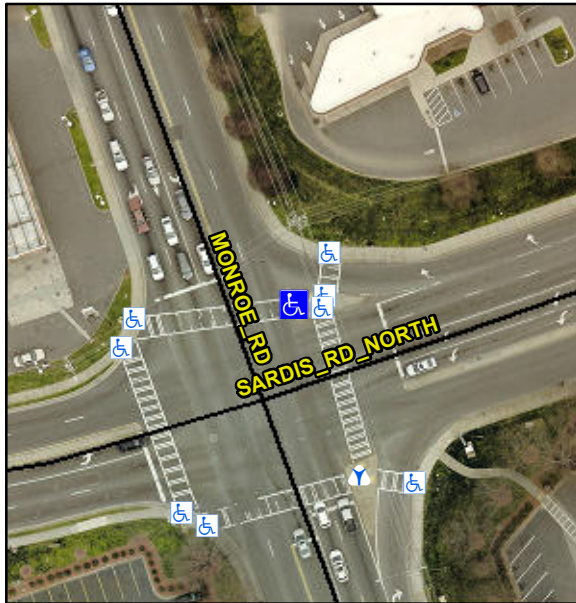

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.**

Surveyor Notes:

**LOCATED ON MEDIAN**

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7**

Total Cost: \$ 3700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	105.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	50.0	No	BlendTrans XSlope (%)	3.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	6.0	N/A	Flare Slope RT (%)	12.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.6	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	0.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	108.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0		Clear Space?	Yes
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.0

