


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27411	Main Street: BALLANTYNE_COMMONS_PY	Cross Street: BALLANTYNE_CORPORATE_PL	Location: SE
ADA ID: EF457DF5F130	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

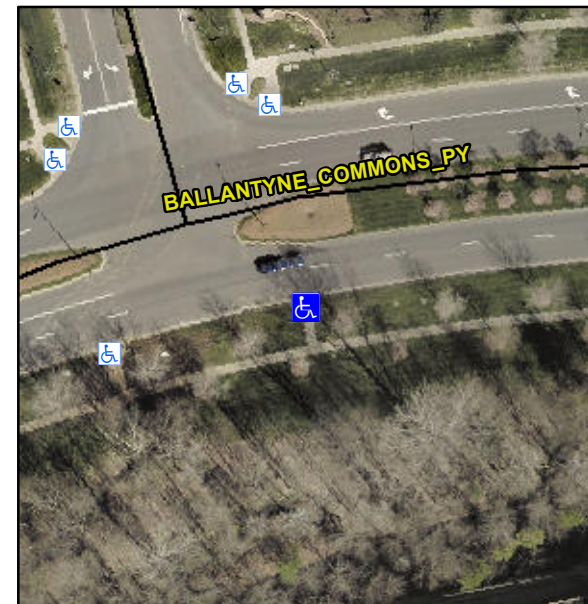

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305, R302.7.2, R304.5.4

Street 1 Name **BALLANTYNE COMMONS PY**
 Stop Condition-Street 2 **None**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

Total Cost: \$ **2600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	130.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.5	Yes	Flare Slope RT (%)	2.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	77.0	No	DWS Provided?	No
Yes	Landing Width (in)	59.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	2.1	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.4
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

