




Access Compliance Report Public Rights-of-Way (Curb Ramps)

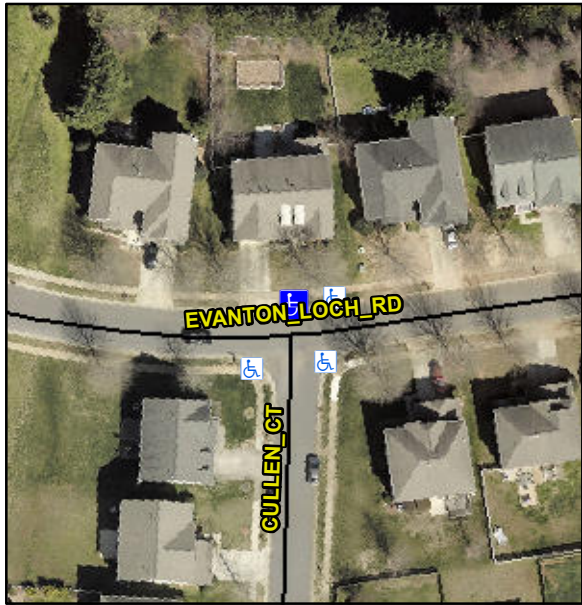

Intersection ID: 48421	Main Street: EVANTON_LOCH_RD	Cross Street: CULLEN_CT	Location:	N
ADA ID: EF820AB0B28D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A		Ramp Length (in)	46.0	No	Ramp Slope (%)	9.5	
			No		Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	1.0	
			N/A		Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A		Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A		Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A		Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A		Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A		Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A		Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Surveyor Notes:	N/A		N/A		Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
			N/A		Shared Landing?	N/A				
			N/A		Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A		Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A		Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
					X Walk 1 Direction	To SW		X Walk 2 Direction	N/A	
			N/A		X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
					X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	N/A	
					X Walk 1 X Slope (%)	5.1		X Walk 2 X Slope (%)	N/A	
			N/A		Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
PROW/ADA:	R304.5.1, R304.2.2				Road Slope (%)	N/A	N/A	Clear Space?	N/A	
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
			N/A		Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
					Obstruction Type			Storm Grate/Utility Type		
						N/A			N/A	
							Yes	Surface Condition? (G/P)	Good	
Street 1 Name		EVANTON LOCH RD								
Stop Condition-Street 2		None								
Street 2 Name		N/A								
Stop Condition-Street 1		N/A								
Total Cost:			\$	1850.00						

