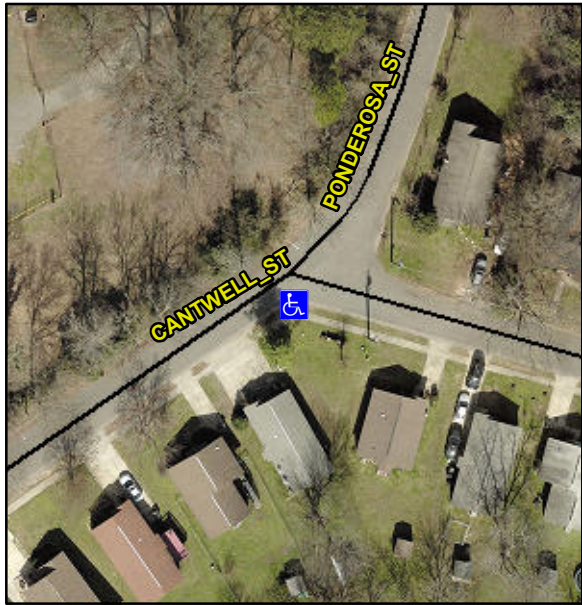


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8395	Main Street: PONDEROSA_ST	Cross Street: CANTWELL_ST	Location:	S
ADA ID: EF8CF0F7F772	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>CANTWELL ST</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div> <div>Street 2 Name<div>CANTWELL ST</div></div> <div>Stop Condition-Street 2<div>None</div></div>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	4.0	
		Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	8.7	
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Surveyor Notes: N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
	PROW/ADA: Not Found, R304.5.3	N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To NE		X Walk 2 Direction	To W	
			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	5.6		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
Total Cost: \$ 3200.00		Road Slope (%)	5.6		Clear Space?	N/A		
		Road X Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A		
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		Obstruction Type			Storm Grate/Utility Type			
			N/A			N/A		
				Yes	Surface Condition? (G/P)	Good		
				No	Curb Slope (%)	7.5		

