


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12101	Main Street: N_TRYON_ST	Cross Street: E_6TH_ST	Location:	E
ADA ID: F007F97088A4	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 2.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

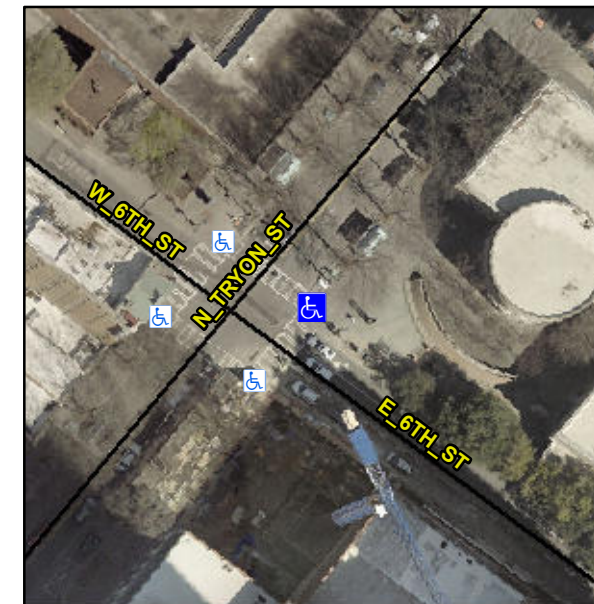

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	8.0
Yes	Ramp Width (in)	63.0	Yes	Ramp XSlope (%)	1.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.4	Yes	Flare Slope RT (%)	6.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	109.0	N/A	X Walk 2 Width (in)	147.0
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	0.8
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	1.3	Yes	Clear Space to XWalk (in)	51.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes	Yes	Surface Condition? (G/P)	Good

