


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 44555	Main Street: UNIVERSITY_CITY_BV	Cross Street: N_TRYON_ST	Location: SE
ADA ID: F0ECED4AE35B	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 15
			Field Measurements/Component Compliance

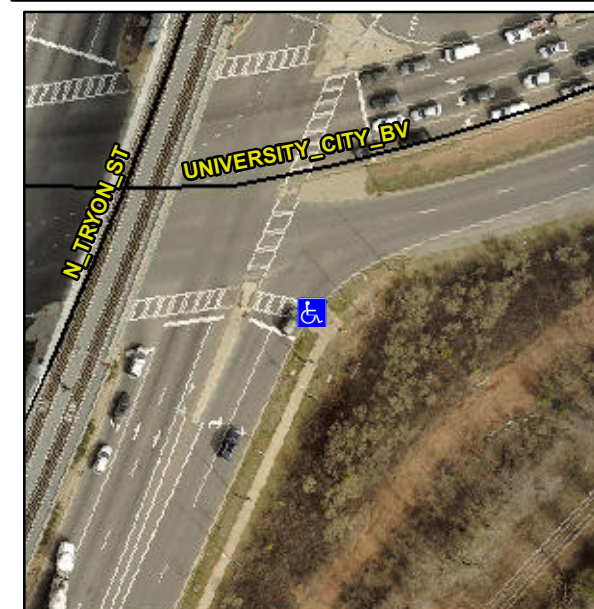

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2, R302.7, R302.7.2**

Total Cost: \$ 1850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97.0	Yes	Ramp Slope (%)	6.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.7	N/A	Flare Slope RT (%)	7.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.4
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	114.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

