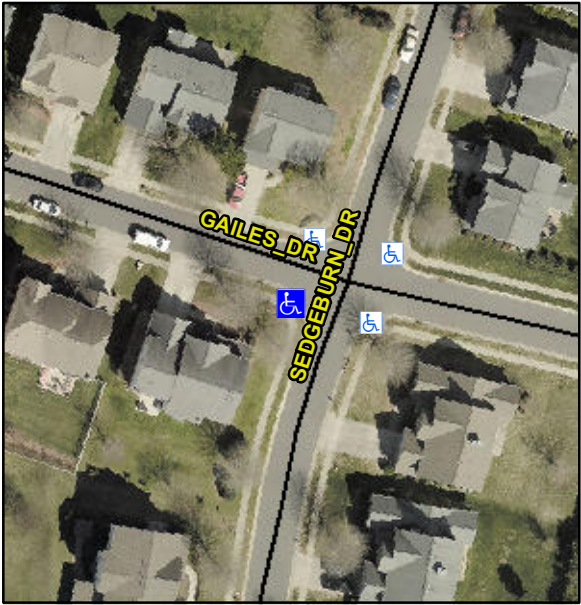


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47573	Main Street: SEDGEBURN_DR	Cross Street: GAILES_DR	Location: SW
ADA ID: F124538B205A	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:			
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			
<p>Surveyor Notes:</p> <p>N/A</p>	<p>PROW/ADA:</p> <p>R304.2.2, R304.5.3</p>	Compliance	Description	Data
		N/A	Ramp Length (in)	47.0
		Yes	Ramp Width (in)	48.0
		N/A	Flare Type LT	N/A
		N/A	Flare Slope LT (%)	N/A
		N/A	Flare Traversable LT?	N/A
		N/A	Landing Length (in)	N/A
		N/A	Landing Width (in)	N/A
		N/A	Landing Slope (%)	N/A
		N/A	Landing X Slope (%)	N/A
		N/A	Landing Curb? (Y/N)	N/A
		N/A	Shared Landing?	N/A
		N/A	Gutter Ponding?	N/A
		N/A	Gutter Lip Ht (in)	N/A
		N/A	Painted X Walk1?	No
			X Walk 1 Direction	To SE
		N/A	X Walk 1 Width (in)	N/A
			X Walk 1 Slope (%)	5.4
			X Walk 1 X Slope (%)	0.4
		N/A	Ramp inside XWalk1?	N/A
			Road Slope (%)	2.8
			Road X Slope (%)	1.9
		N/A	Any Obstructions?	N/A
			Obstruction Type	
				N/A
		Yes	Surface Condition? (G/P)	Good

