

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11140	Main Street: N_SYCAMORE_ST	Cross Street: W_5TH_ST	Location: S
ADA ID: F13BD85735E9	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

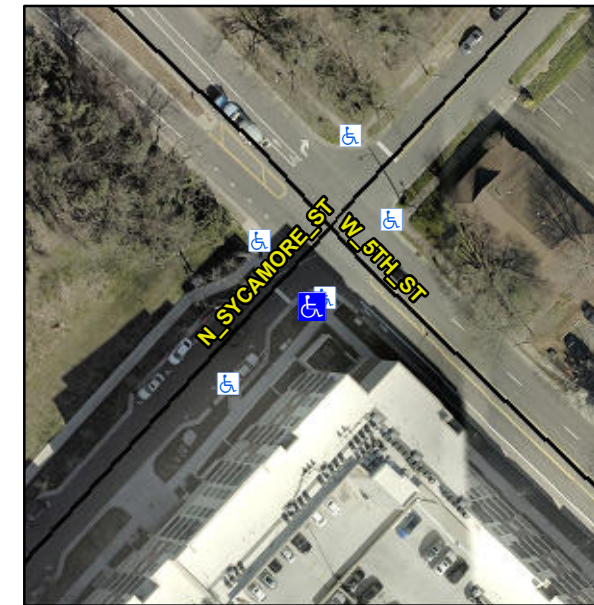

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	70.5	No	Grade Break Slope (%)	6.7
Yes	Ramp Slope (%)	6.8	No	Grade Break XSlope (%)	3.8
Yes	Ramp XSlope (%)	1.5			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	30.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	6.6
N/A	Painted X Walk1?	No		Road Slope (%)	2.8
	X Walk 1 Direction	To NW		Road X Slope (%)	4.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.4

Total Cost: \$ 2350.00

Street 1 Name N SYCAMORE ST
Stop Condition-Street 1 StopSign
Street 2 Name N/A
Stop Condition-Street 2 N/A

