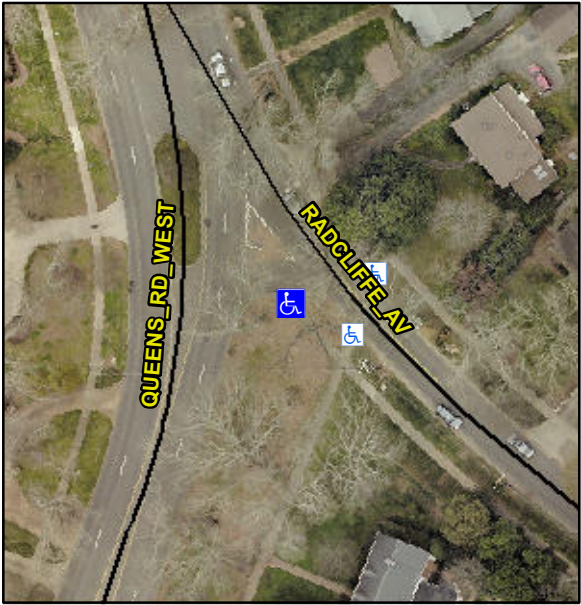


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                             |   |                        |
|---|-----------------------------|---|------------------------|
| Intersection ID: 16107                  | Main Street: QUEENS_RD_WEST | Cross Street: RADCLIFFE_AV              | Location: SE           |
| ADA ID: F13C4AD3D35A                    | Ramp Type: PerpDiag         | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                             | Field Measurements/Component Compliance |                        |
| Severity Score: 33.75                   |                             |   |                        |

|  |  |  |            |  |                       |  |       |            |                             |      |
|--|--|--|------------|--|-----------------------|--|-------|------------|-----------------------------|------|
|  | Possible Solutions:  |  | Compliance |  | Description           |  | Data  | Compliance | Description                 | Data |
|  | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. |  | N/A        |  | Ramp Length (in)      |  | 89.0  | Yes        | Ramp Slope (%)              | 5.8  |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>     |  |  | No         |  | Ramp Width (in)       |  | 43.0  | No         | Ramp XSlope (%)             | 7.4  |
|  |  |  | N/A        |  | Flare Type LT         |  | N/A   | N/A        | Flare Type RT               | N/A  |
|  |  |  | N/A        |  | Flare Slope LT (%)    |  | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
|  |  |  | N/A        |  | Flare Traversable LT? |  | N/A   | N/A        | Flare Traversable RT?       | N/A  |
|  |  |  | N/A        |  | Landing Length (in)   |  | N/A   | N/A        | DWS Provided?               | N/A  |
|  |  |  | N/A        |  | Landing Width (in)    |  | N/A   | N/A        | DWS Contrast?               | N/A  |
|  |  |  | N/A        |  | Landing Slope (%)     |  | N/A   | N/A        | DWS Length (in)             | N/A  |
|  |  |  | N/A        |  | Landing X Slope (%)   |  | N/A   | N/A        | DWS Full Width?             | N/A  |
|  |  |  | N/A        |  | Landing Curb? (Y/N)   |  | N/A   | N/A        | DWS Offset (in)             | N/A  |
|  |  |  | N/A        |  | Shared Landing?       |  | N/A   |            |                             |      |
|  |  |  | N/A        |  | Gutter Ponding?       |  | N/A   | N/A        | Gutter Slope (%)            | N/A  |
|  |  |  | N/A        |  | Gutter Lip Ht (in)    |  | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
|  |  |  | N/A        |  | Painted X Walk1?      |  | No    | N/A        | Painted X Walk2?            | No   |
|  |  |  |            |  | X Walk 1 Direction    |  | To NE |            | X Walk 2 Direction          | To W |
|  |  |  | N/A        |  | X Walk 1 Width (in)   |  | N/A   | N/A        | X Walk 2 Width (in)         | N/A  |
|  |  |  |            |  | X Walk 1 Slope (%)    |  | 3.7   |            | X Walk 2 Slope (%)          | 0.9  |
|  |  |  |            |  | X Walk 1 X Slope (%)  |  | 0.7   |            | X Walk 2 X Slope (%)        | 3.1  |
|  |  |  | N/A        |  | Ramp inside XWalk1?   |  | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|  |  |  |            |  | Road Slope (%)        |  | 4.2   | N/A        | Clear Space?                | N/A  |
|  |  |  |            |  | Road X Slope (%)      |  | 4.0   | N/A        | Clear Space to XWalk (in)   | N/A  |
|  |  |  | N/A        |  | Any Obstructions?     |  | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|  |  |  |            |  | Obstruction Type      |  |       |            | Storm Grate/Utility Type    |      |
|  |  |  |            |  |                       |  |       | N/A        |                             | N/A  |
|  |  |  |            |  |                       |  |       | Yes        | Surface Condition? (G/P)    | Good |

Total Cost: \$ 3200.00

