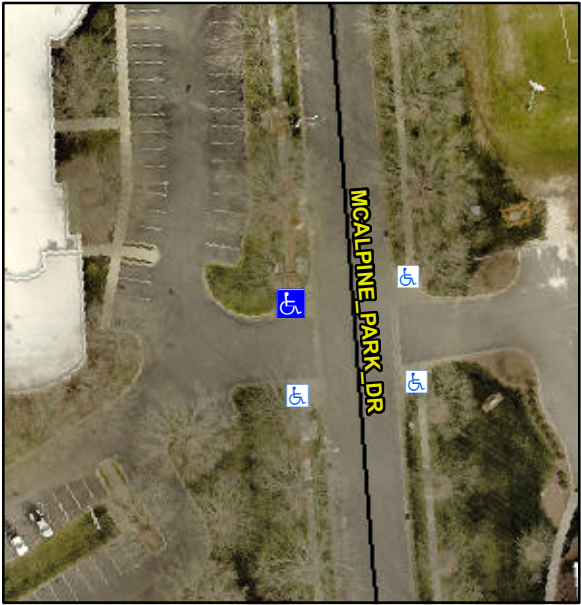


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10031405	Main Street: MCALPINE_PARK_DR	Cross Street: N/A	Location: NW
ADA ID: F14C44A907A8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 33.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	65.5	No	Ramp Slope (%)	9.6
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>			No	Ramp Width (in)	45.0	No	Ramp XSlope (%)	6.4
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
<p>Street 1 Name</p> <p>ENTRANCE</p> <p>Stop Condition-Street 2</p> <p>None</p> <p>Street 2 Name</p> <p>MCALPINE PARK DR</p> <p>Stop Condition-Street 1</p> <p>None</p>			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To S		X Walk 2 Direction	To E
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	2.9
				X Walk 1 X Slope (%)	9.5		X Walk 2 X Slope (%)	3.7
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	3.5	N/A	Clear Space?	N/A
				Road X Slope (%)	8.8	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A		N/A
			Yes	Surface Condition? (G/P)				Good

