

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16357	Main Street: MONROE_RD	Cross Street: ROSS_MOORE_AV	Location: SW
ADA ID: F169C4C2062A	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 15	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

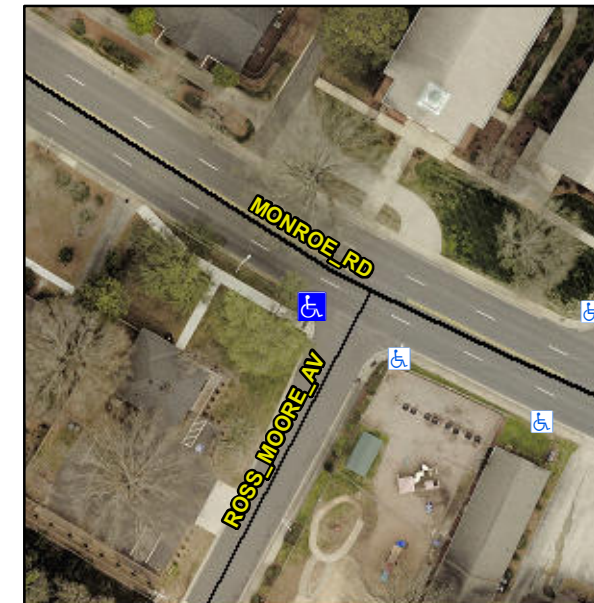

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

ASP LIP 1.0

PROW/ADA:

Not Found, R304.2.1, R304.5.3, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	24.0	Yes	BlendTrans Slope (%)	3.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	4.7	Yes	Flare Slope RT (%)	2.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	36.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	25.0
No	Landing X Slope (%)	2.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	3.9
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8		Clear Space?	Yes
	Road X Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	16.3

Street 1 Name ROSS MOORE AV
 Stop Condition-Street 1 StopSign
 Street 2 Name MONROE RD
 Stop Condition-Street 2 None

