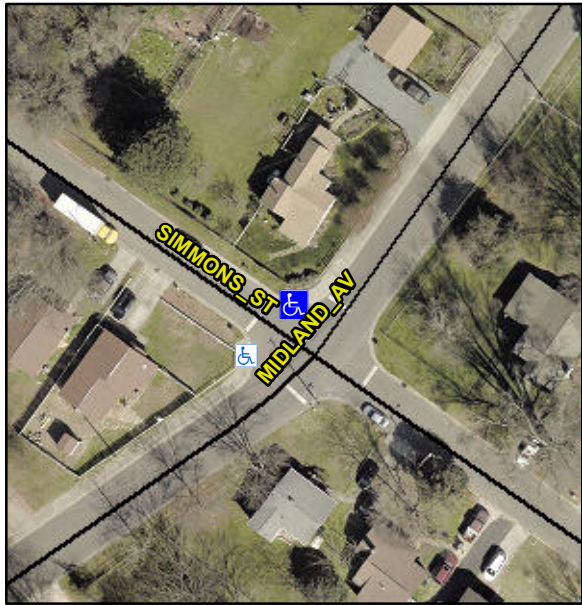


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11982	Main Street: MIDLAND_AV	Cross Street: SIMMONS_ST	Location:	N
ADA ID: F18BA89A875F	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 NameSIMMONS ST</div> <div>Stop Condition-Street 1StopSign</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	73.0	Yes	BlendTrans Slope (%)	4.3
			No	Ramp Width (in)	45.0	Yes	BlendTrans XSlope (%)	1.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A				
PROW/ADA:		Not Found, R304.5.1	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.0		Clear Space?	N/A
				Road X Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						No	Curb Slope (%)	17.7
Total Cost:		\$ 3200.00						

