

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 10011741 Main Street: N_SHARON_AMITY_RD Cross Street: N/A Location: SE

ADA ID: F1A96673BEF6 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

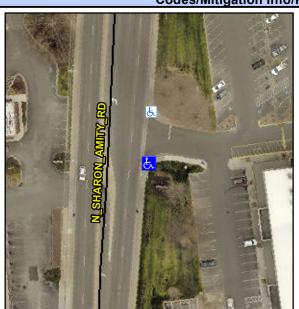

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

ENTRANCE StopSign N SHARON AMITY RD None Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

Field Measurements/Component Compliance					
Co	Compliance Description		Comp	oliance Description	Data
N/	A Ramp Length (in)	59.0	Yes	Ramp Slope (%)	6.1
No	Ramp Width (in)	40.0	No	Ramp XSlope (%)	7.3
N/	A Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/	A Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/	A Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/	A Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/	A Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/	A Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/	A Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/	A Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/	A Shared Landing?	N/A			
N/	A Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/	A Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/	A Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/	A X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	7.3		X Walk 2 X Slope (%)	1.2
N/	A Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9	N/A	Clear Space?	N/A
	Road X Slope (%)	6.1	N/A	Clear Space to XWalk (in)	N/A
N/	A Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
	77V . 1		-	. ,	





