


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 54193	Main Street: SYCAMORE CENTRE DR	Cross Street: TYVOLA CENTRE DR	Location: NE
ADA ID: F22657786F66	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 0
			Field Measurements/Component Compliance

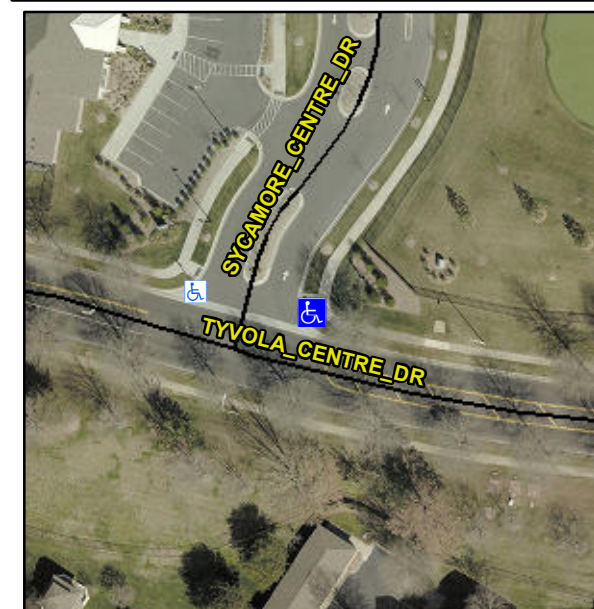

Possible Solutions:

**Remove & Replace Detectable
Warning System.**

Surveyor Notes:

N/A

PROW/ADA:

R305.2

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	98.0	Yes	BlendTrans Slope (%)	1.1
Yes	Ramp Width (in)	69.0	Yes	BlendTrans XSlope (%)	1.2
Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type R	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	73.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.3		Clear Space?	Yes
	Road X Slope (%)	3.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.3

Street 1 Name	SYCAMORE CENTRE DR
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

