


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3040		Main Street: FOX_GLEN_RD		Cross Street: RED_TAIL_CT		Location: SE											
ADA ID: F26581E0DA5D		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		22.0		N/A		Grade Break?		N/A	
Surveyor Notes:				N/A		Yes		Ramp Width (in)		56.0		N/A		Grade Break Slope (%)		0.0	
						No		Ramp Slope (%)		10.7		N/A		Grade Break XSlope (%)		0.0	
PROW/ADA:				R304.2.2, R304.5.3		No		Ramp XSlope (%)		4.8							
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
Street 1 Name				RED TAIL CT		N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0	
				StopSign		N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
Street 2 Name				N/A		N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A	
				N/A		N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A	
Stop Condition-Street 1						N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A	
						N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A	
Stop Condition-Street 2						N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A	
						N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A	
Total Cost:				\$ 1600.00		N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A	
								N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)	
						N/A		Painted X Walk1?		No				Road Slope (%)		4.1	
								X Walk 1 Direction		To SW				Road X Slope (%)		2.8	
						N/A		X Walk 1 Width (in)		N/A				Clear Space?		N/A	
								X Walk 1 Slope (%)		4.1		N/A		Clear Space to XWalk (in)		N/A	
						N/A		X Walk 1 X Slope (%)		2.8		N/A		Storm Grate/Utility Hazard?		N/A	
								Ramp inside XWalk1?		N/A				Storm Grate/Utility Type			
						N/A		Any Obstructions?		N/A						N/A	
								Obstruction Type				Yes		Surface Condition? (G/P)		Good	
										N/A		N/A		Curb Slope (%)		N/A	

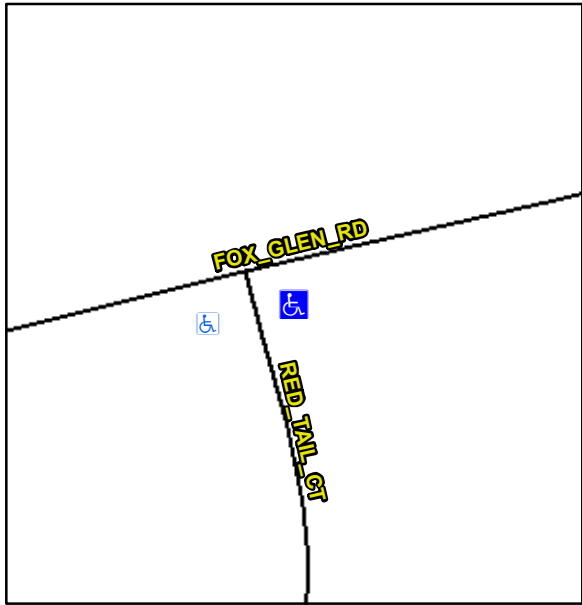